

Installation Guide
Code CR2AG-A31 and Code 2600 Barcode Scanner Wall Mount Kit

The purpose of this guide is to describe assembly and installation of the Code Barcode Scanner Wall Mount Kit.

Parts Reference

The following parts and hardware are included in this installation kit (hardware not shown).

Item #	Description	Qty
1	Code Scanner Mount	1
2	10-32 x 1/2" Socket Head Cap Screw (SHCS)	3
3	8-32 x 5/16" Pan Head Mounting Screw (PHMS)	4
4	5/32" Hex Wrench	1
5	8-32 x 1/4" Flat Head Machine Screw (FHMS)	4



Tools Required


Phillips Screwdriver (Not provided)
5/32" Hex Wrench (Provided)

Installation Note

Power Cord must be installed into the Code Barcode Scanner Base prior to mounting. Do not plug Power Cord into power outlet during installation.

Attaching Code CR2AG-A31 Scanner Base to Mount

Align the (4) mounting through holes on the Code Barcode Scanner Base with the (4) threaded holes on the mount. Position the Power Cord on the left or right cut-out detail on the Base. Fasten Base to mount with (4) 8-32 x 5/16" PHMS.

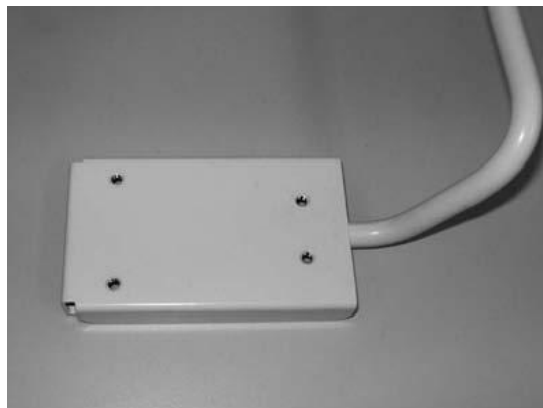


Attaching Code 2600 Barcode Scanner Base to Mount


Installation Note

The accessory Adapter Plate is supplied by Code Corporation. Power Cord and USB cable must be installed into the Code Barcode Scanner Base prior to mounting. Do not plug Power Cord into power outlet during installation.

Align the (4) mounting through holes on the Adapter Plate with the (4) threaded holes on the mount. Using a Phillips screwdriver, fasten Adapter Plate to mount with (4) 8-32 x 1/4" FHMS.

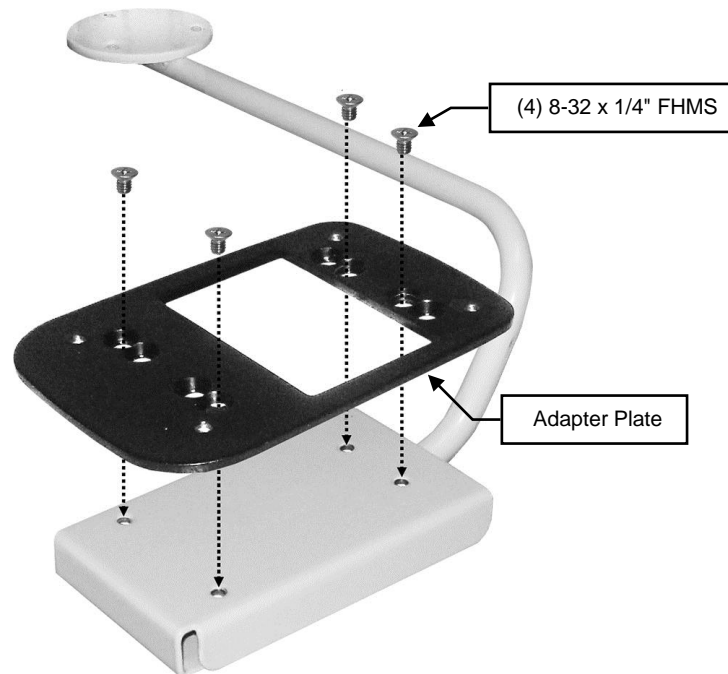


Install Power Cord and USB Cable in to Scanner Base per manufacturer's instructions. Fasten Base to Adapter Plate with (4) Pan Head screws included with the Adapter.

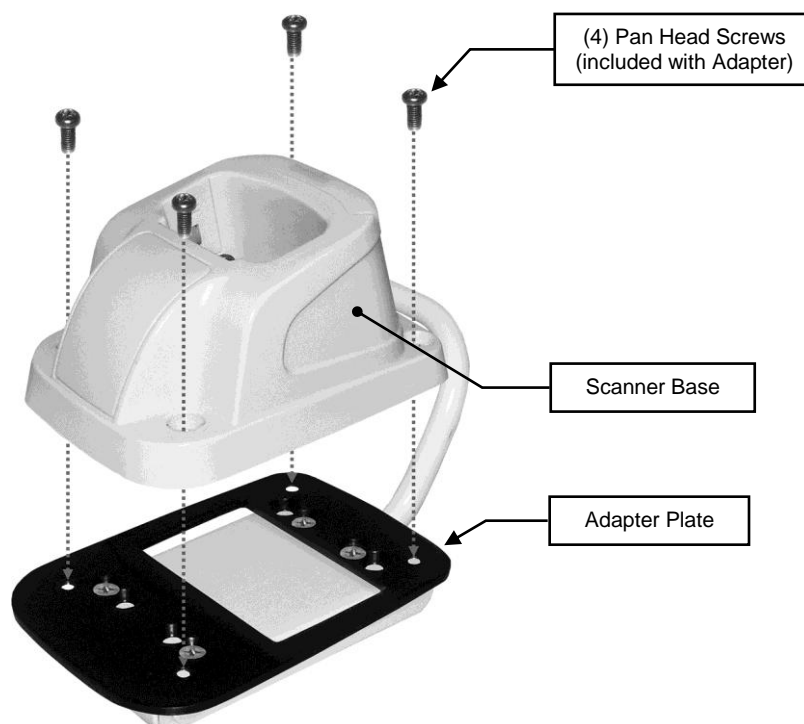

Attaching Code Barcode Scanner Mount to GCX M-Series / VHM Arm

Install Scanner Mount to the lower front end swivel cup mounting holes with (3) 10-32 x 1/2" SHCS and the 5/32 Hex Wrench.

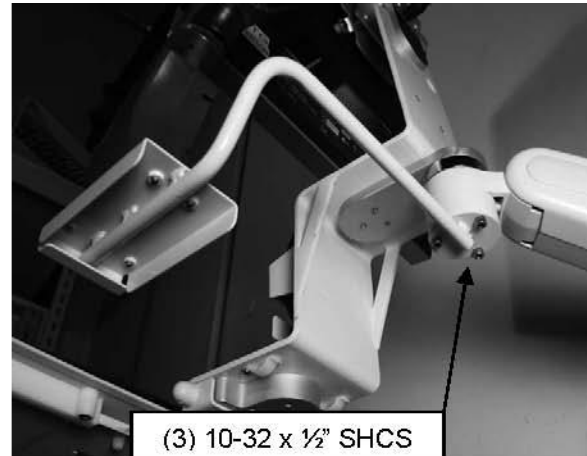

Routine Maintenance

Periodically inspect all hardware associated with the mounting system. Tighten or adjust as necessary for optimal operation and safety.

Cleaning the Mounting Assembly

1. The mounting assembly may be cleaned with most mild, non-abrasive solutions commonly used in the hospital environment (e.g. diluted bleach, ammonia, or alcohol solutions).
 2. The surface finish will be permanently damaged by strong chemicals and solvents such as acetone and Trichloroethylene.
 3. Do not use steel wool or other abrasive material to clean the mounting assembly.
 4. Damage caused by the use of unapproved substances or processes will not be covered by warranty. We recommend testing of any cleaning solution on a small area of the arm that is not visible to verify compatibility.
 5. Do not submerge or allow liquids to enter the mounting assembly. Wipe any cleaning agents off of the arm immediately using a water dampened cloth. Dry the mounting assembly thoroughly after cleaning.
- CAUTION:** GCX makes no claims regarding the efficacy of the listed chemicals or processes as a means for controlling infection. Consult your hospital's infection control officer or epidemiologist. To clean or sterilize mounted instruments or accessory equipment, refer to the specific instructions delivered with those products